



**Product Support Bulletin N° PSB002**  
31 July 1997

**Ventura HUD Monitor Blanking Problem and Solution**


**Introduction**

A small number of Ventura users have experienced problems with the monitor(s) blanking and locking up.

Investigation has revealed that this is being caused by a poor earth connection between the monitor connector and the mounting plate.

This is simply resolved by fitting shakeproof washers under the monitor cable retaining screws. The screws in question are marked on the attached drawing. The shakeproof washers should be fitted under each screw and to both connectors on a twin HUD version.

This will fully resolve this problem but if you have any questions do not hesitate to contact Celco Product Support.

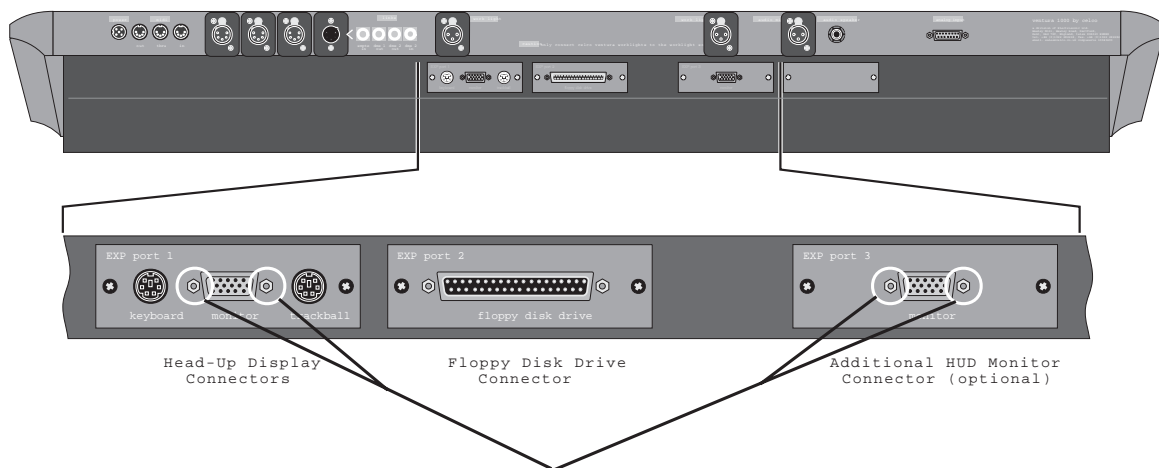

Fit shakeproof washers under these retaining screws